



Firmware Version: 1.30rc055

Published Date: 2013/11/08

Content:

Upgrading Instructions:..... 2
 Upgrading by using Web-UI..... 2
New Features:..... 2
Changes of MIB & D-View Module:..... 3
Problems Fixed: 3
Known Issues: 4
Related Documentation: 4

Revision History and System Requirement:

Firmware Version	Date	Model	Hardware Version
1.26rc028	2012/10/08	DAP-2553	A1


Upgrading Instructions:

D-Link AP supports firmware upgrading via Web-UI. You may download the firmware from D-Link web site <http://tsd.dlink.com.tw>.

Upgrading by using Web-UI

1. Connect a work station to the LAN port of Access Point.
2. Open the web browser of work station and entering the IP address of the AP. The system default IP address is 192.168.0.50.
3. Enter administrator's username and password, user name is "admin" and leave the password field blank by default.

To update the AP's firmware, click **Maintenance > Firmware and SSL Certification Upload**

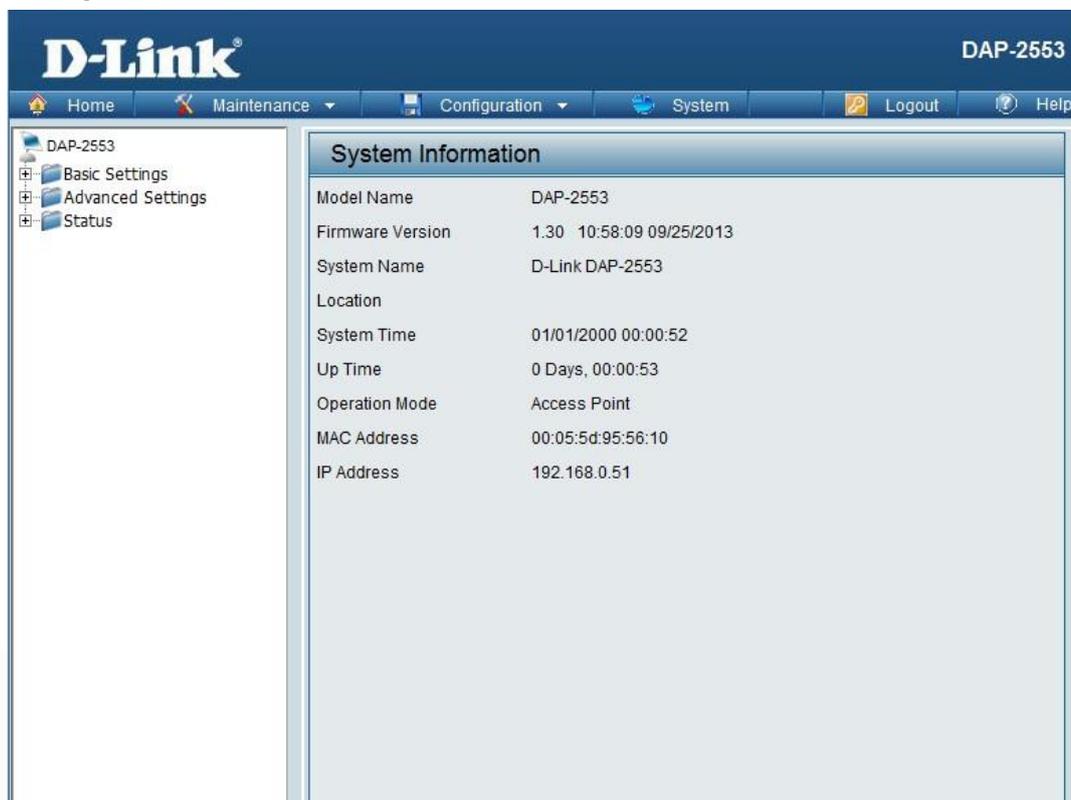

New Features:

1. Add cmd in CLI to support tftp upload/download XML configuration
2. Support APMII Lite Platform
3. Support DNS client
4. Add encrypt in MIB module for user password node
5. Update power table for CN/RU/JP country code
6. Add node deviceInformationFirmwareNum in MIB module
- 7.

Changes of MIB & D-View Module:

None

Problems Fixed:

Firmware Version	Problems Fixed
V1.30	<ol style="list-style-type: none"> 1. Fix no 2013 selection issue on Web/Time&Date 2. Improve the design of ifindex table in MIB1213 3. Fix IOT issue with BCM43xx 4. Fix disconnect issue when transfer big size file 5. Fix AP Array abnormal exit and suspending 6. Fix wireless schedule rule failed. 7. Fix the information for STA's Power Saving status 8. Fix the large ping response time between 2 wireless clients 9. Fix [SNMP] SSID shows incorrectly client info when connect with MSSID 10. Fix memory leak issue when the ARP packets which generate from the device 11. Fix when wireless band is 5Ghz,console information show error 12. Fix Current IP Mapping List static pool show error. 13. Fix Time and Date the max year can be set should be 2037. 14. Fix Schedule can add more than two schedule rules for same SSID in Schedule Rule List. 15. Fix XML config -> get xmlconfig on CLI, the web page show wrong information 16. Fix bug of [Short GI] : When security is WEP or TKIP, short GI should be disable and gray. 17. Fix bug of [AP Array] : When modify master ap some cfg, save and active , sometimes backup master ap will syn the cfg all the time. 18. Fix bug of [Email]: IP address and mac address show error in Email. 19. Fix bug of [Periodical key change]: restart device will Initiate Wireless for twice. 20. Fix bug of [Wireless]: RSADIUS secret's length should be 1~ 64. 21. Fix bug of Input "http://192.168.0.50/model/__show_info.php?REQUIRE_FILE=var/etc/httpasswd" with AP not login, it display the username and password also, it should not display this message with AP not login 22. Fix Web security issue

- | | |
|--|---|
| | <ul style="list-style-type: none">23. Fix APC reboot issue in endurance test24. Improve the connection endurance in long time test25. Fix when running the BT endurance fail, AP will reboot when run after 12~15 hours26. Fix client AP can't use TKIP to connect root AP27. Fix E-mail Server should support Domain in E-mail setting |
|--|---|

Known Issues:

Firmware Version	Known Issues

Related Documentation:

- DAP-2553 User Manual v1.3